

SERVICE BULLETIN

NO. FA-004

FUJI HEAVY INDUSTRY WORK

DATE Sept 8, 1969

1. SUBJECT : Inspection of carburetor heater valve (or alternate air valve).
2. AIRCRAFT AFFECTED: FA-200 (Serial Nos. 3 through 55 airplane)
3. PRIORITY : Essential.
4. REASON : Inspection of carburetor heater (or alternate air) valve shaft and bearing for wear. (Abnormal wear occurred on JA3422 at the 300 flight hour.)
5. DESCRIPTION : Inspect the carburetor heater or alternate air valve shaft and bearing and if the play is over 2 mm (.08 inch), replace the valve ass'y to new designed one.
6. ACCOMPLISHMENT: At the next 50-hour inspection.
7. APPROVAL : JCAB Approval No. 302 8, Sept. 1969.
8. PARTS REQUIRED: Parts number of valve ass'ys are as follows;

New designed valve	FA-200-160	200-914124-101
	FA-200-180	203-914121-015
Valve used now	FA-200-160	200-914124-001
	FA-200-180	203-914121-011

9. SPECIAL TOOL : Nothing.
10. WEIGHT AND BALANCE: No change.
11. REFERENCE : Nothing.
12. MAN POWER : A little.