



SERVICE BULLETIN

NO. FAS-030


Fuji Heavy Industries, Ltd.

DATE July 30, 1970

1. SUBJECT : Provision of rubber seal on front canopy stay.
2. AIRCRAFT AFFECTED : FA-200 Serial Nos. 1 through 86.
3. PRIORITY : Essential.
4. REASON : In order to prevent canopy glass damage or vibration noise in case that the glass comes in contact with the stay at high speed flight.
5. DESCRIPTION : Provision of rubber seal on front canopy stay.
6. ACCOMPLISHMENT : This instruction shall be accomplished within 25 hours after receipt of this bulletin.
7. APPROVAL : JCAB Approval NO-TOKYO-004 July 22, 1970
8. PARTS REQUIRED : The following parts, adhesive not included, shall be furnished owner without fee.

PARTS NUMBER	NAME	QUANTITY
F-0483-10700	SEAL RUBBER	1
CEMEDINE 575 or EQUIVALENT	ADHESIVE	AR

9. SPECIAL TOOLS : None

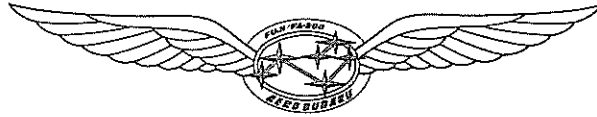

10. WEIGHT AND BALANCE : Negligible.

11. REFERENCE : None.


12. MANPOWER : 1 man hour.

13. WORK PROCEDURE : After cleaning bonded area of stay, bond
the rubber seal with adhesive.



Bond #0483-10700
rubber seal with
adhesive (cemedine 575)

Front canopy stay

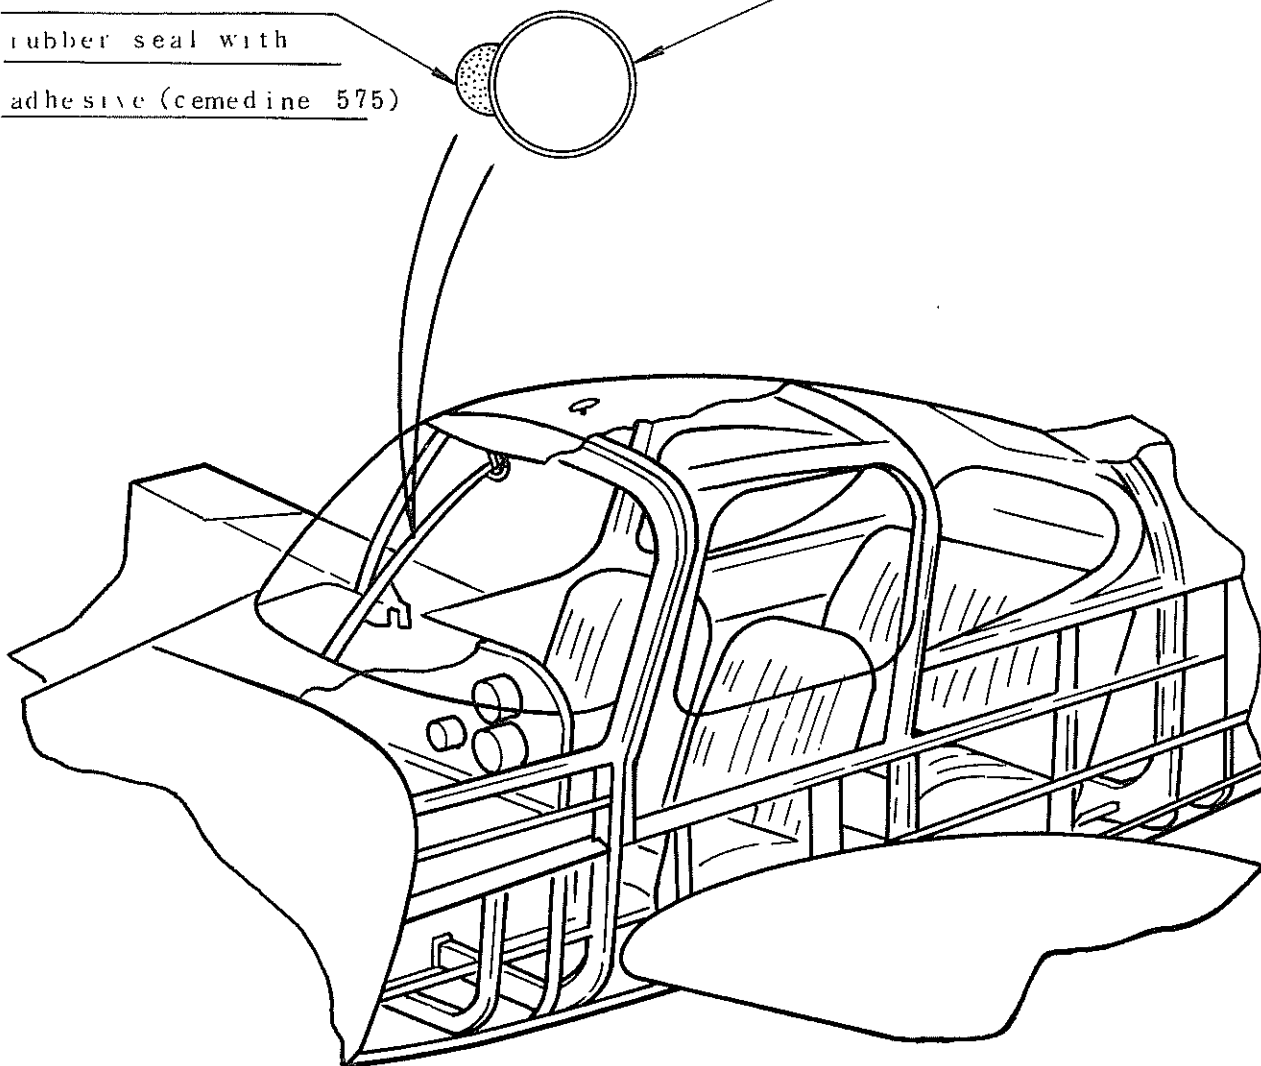

Caution When bonding rubber seal, care shall be exercised so as not to apply adhesive on the front glass. Masking the affected glass area with paper or other proper material is recommended.