



SERVICE BULLETIN

FUJI HEAVY INDUSTRIES LTD.

HEAD OFFICE

: SUBARU BLDG,
SHINJUKU, TOKYO, JAPAN

NO : FAS-044

DATE : February 15, 1971

1. SUBJECT : Development of seat with reclining device.
2. AIRCRAFT AFFECTED : All FA-200 Series, Serial Nos. 1 thru 101.
3. PRIORITY : Optional.
4. REASON : To be possible for angle adjustment of front seat backrest and to improve livings.
5. DESCRIPTION : Front seat is changed with new designed seat with reclining seat.
6. ACCOMPLISHMENT : Optional.
7. APPROVAL : JCAB Approved.
8. PARTS REQUIRED : The following parts are required to perform the rework.

PART NO.	PART NAME	QTY	REMARKS.
200-534210-301	SEAT	2	1. BLACK VINYL LEATHER (optional)
200-534210-303	SEAT	2	2. RED VINYL LEATHER (optional)
200-430401-9	BRACKET	1	
200-430401-11	BRACKET	1	

9. SPECIAL TOOL : None required.

FAS - 044

PAGE 1 OF 2

10. WEIGHT AND BALANCE : Negligible.

11. REFERENCE : None.

12. MANHOUR REQUIRED : 0.5 Manhours required.

13. DETAILED INSTRUCTIONS:

(1) Replacement of the seat will be accomplished in accordance with service manual para. 7-7-1.

(2) To prevent the contact between the seat and band fitting bracket by installing new seat, band fitting bracket is replaced by following procedure.

(a) Remove band fitting bracket, 200-430401-001 & -003, attached center main spar carry-through at back part of the seat, with two bolts.

(b) Install new band fitting bracket, 200-430401-009 & -011, with two bolts.

(3) Remove the placard "BOARDING ON REAR SEAT REMOVE LOCK PINS OF FRONT SEAT BACKREST" attached to ash tray.